PRINTED: 11/30/2015 FORM APPROVED

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 HAL084004 11/04/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 SUMMARY STATEMENT OF DEFICIENCIES (X5) COMPLETE (X4) ID PROVIDER'S PLAN OF CORRECTION PRÉFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (EACH CORRECTIVE ACTION SHOULD BE TAG REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG DEFICIENCY) C 000 C 000 Initial Comments It is the community's standard practice to Report of Biennial Construction Survey by Dennis comply with the referenced regulations. Harrell and Ed Miller on 11-4-2015. Records indicate this facility was first licensed as a Home for the Aged serving 78 residents on Plan of Correction: 10-27-1997. Therefore the facility must meet the 1996 Rules for Adult Care Homes, the applicable The door between the laundry room and soiled portions of the 2005 Rules for the Licensing of linen room is to be closed. Linen covers for the Adult Care Homes of Seven or More Beds and barrels have been placed on each one stored in the 1996 North Carolina State Building Code Section 409.1 Group I -Institutional Occupancylinen room. Unrestrained. Deficiencies were noted which will require a new Plan of Correction. Prevention of Re-occurrence: Signage has been placed on doorway and on C 140 Linen Storage-Separate Clean & Soiled C 140 each linen cart lid. SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (f) The requirements for storage rooms and Monitor Responsibility & Frequency: closets are: (2) Linen Storage. Storage areas shall be Maintenance Director and Executive Director to adequate in size and number for separate monitor on a regular basis. storage of clean linens and separate storage of soiled linens. Access to soiled linen storage shall be from a corridor or laundry room; Plan of Correction Completion Date: This Rule is not met as evidenced by: Based on observation, the clean linens were not November 11, 2015 properly separated from the soiled linens. Failure to separate clean and soiled linens can cause the clean linens to become re-contaminated. Findings include: The door between the laundry and the clean linen room was found to be propped open. b. There was an unpleasant odor in the laundry. c. The soiled linen tubs were being stored in the ivision of Health Service Regulation

ABORATORY DIRECTOR'S OR PROVIDER/SUPPLIER REPRESENTATIVE'S SIGNATURE

Lehrn Manu

TITLE

(X6) DATE

Executive Director

Division of Health Service Regulation (X1) PROVIDER/SUPPLIER/CLIA STATEMENT OF DEFICIENCIES (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY COMPLETED IDENTIFICATION NUMBER: AND PLAN OF CORRECTION A. BUILDING: 01 B. WING HAL084004 11/04/2015 STREET ADDRESS, CITY, STATE, ZIP CODE NAME OF PROVIDER OR SUPPLIER 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 (X5) COMPLETE DATE SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL (EACH CORRECTIVE ACTION SHOULD BE PREFIX PRÉFIX REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DEFICIENCY) C 140 C 140 Continued From page 1 clean linen room without covers. C 150 It is the community's standard practice to C 150 Corridors-Free of equipment and Obstructions comply with the referenced regulations. SECTION .0300 - PHYSICAL PLANT 10A NCAC 13F .0305 PHYSICAL ENVIRONMENT (g) The requirements for corridors are: Plan of Correction: (4) Corridors shall be free of all equipment and other obstructions. A. The temporary locked door was removed on 11/4/15. This Rule is not met as evidenced by: B. Control door was removed allowing less Based on observation, the facility was remodeling the rear portion of the building and had than 66 feet to left exit. obstructed an exit path from the rear of the facility. Finding include: A temporary locked control door had been Prevention of re-occurrence: installed across the corridor, near room 306, to prevent residents from entering the construction As part of the plan of protection, the door was area. removed and a clear path to exit corridor was The control door results in an obstructed exit provided, along with temporary door, lighting and a single direction exit path (dead end) of to the outside, new walkway with handrail to about 66 feet. sidewalk completed on 11/5/15. The local Fire Marshal, Brian Taylor, was called in for a consultation on how to best correct the current dangerous condition. The following corrections were agreed to and documented in a Plan of Protection. Completion Date: a. Stop construction immediately. b. Clear the exit corridor through the construction November 5, 2015 area. Remove storage from room 306. d. Remove window in room 306 and install a temporary exit door. e. Provide a hard path from new exit to the

for the new exit.

permanent public way at the driveway.

f. Provide lighting at the rear porch of the kitchen

354121

FORM APPROVED Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 HAL084004 11/04/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION (X5) COMPLETE (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG TAG CROSS-REFERENCED TO THE APPROPRIATE DATE DEFICIENCY) C 150 Continued From page 2 C 150 g. Install a guard on each side of the new exit way to direct exiting to the public way and away from the construction areas. h. Construction can resume when the new exit is installed and approved by the local Fire Marshal. C 185 Fire Safety-Rehearsals on Each Shift C 185 Plan of Correction: SECTION .0300 - PHYSICAL PLANT Executive Director spoke with Maintenance 10A NCAC 13F .0309 PLAN FOR Director about performing fire drills in EVACUATION accordance of the state regulations. (b) There shall be rehearsals of the fire plan quarterly on each shift in accordance with the requirement of the local Fire Prevention Code Enforcement Official. Prevention of Re-occurrence: (c) Records of rehearsals shall be maintained and copies furnished to the county department of Binder set up with monthly inspections to be social services annually. The records shall performed by Maintenance Director. Executive include the date and time of the rehearsals, the shift, staff members present, and a short Director to monitor on a regular basis. description of what the rehearsal involved. (f) This Rule shall apply to new and existing facilities. Monitor Responsibility & Frequency: This Rule is not met as evidenced by: Based on review of documents, fire drill Executive Director to monitor on a regular rehearsals are not being done regularly with at basis. least one per shift each quarter. Failure to rehearse the fire plan could lead to confusion and delay in an actual emergency. Findings include: Plan of Correction Completion Date: a. In the 1st quarter of this year, there were no rehearsals done during the 2nd and 3rd shifts. November 4, 2015 b. In the 2nd quarter of this year, there was no rehearsal done during the 3rd shift. c. In the 3rd quarter of this year, there was no

rehearsal done on any shift.

Division of Health Service Regulation (X1) PROVIDER/SUPPLIER/CLIA STATEMENT OF DEFICIENCIES (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING HAL084004 11/04/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE COMPLETE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG CROSS-REFERENCED TO THE APPROPRIATE TAG DATE DEFICIENCY) C 189 Continued From page 3 C 189 C 189 Building Equipment Maintained Safe, Operating C 189 Plan of Correction: SECTION .0300 - PHYSICAL PLANT 1. A designated person was brought in to 10A NCAC 13F .0311 OTHER perform fire walks with no other duties REQUIREMENTS on 11/4/15 and to continue until alarm (a) The building and all fire safety, electrical, mechanical, and plumbing equipment in an adult sprinkler system is back in operation. care home shall be maintained in a safe and 2. Door that did not latch appropriately operating condition. were repaired to operate accordingly (k) This Rule shall apply to new and existing on 11/5/15. facilities with the exception of Paragraph (e) 3. Makson, monitoring company, was which shall not apply to existing facilities. notified of the improper magnetization not working appropriately on 11/5/15. This Rule is not met as evidenced by: 4. Battery powered emergency lights 1. Based on observation, the facility was not replaced on 11/5/15. maintained in a safe condition because a portion 5. Duct detectors were installed in of the fire sprinkler system was disabled. A fire mechanical rooms and boiler room on sprinkler system that is not in working order is a ???????? potential hazard to all occupants of the building. Findings include: 6. Holes in the ceiling and/or walls a. The fire sprinkler system is composed of a dry repaired on 11/5/15. system for the attic and porches and a wet 7. Appropriate containers for oxygen was system for the heated portions of the facility. delivered on 11/5/15. The dry system had been disabled because of 8. Maintenance director was informed to a bad air compressor. c. The facility was conducting a fire watch until perform monthly safety inspections on the sprinkler system is restored. each fire extinguisher monthly on d. The person conducting the fire watch had 11/4/15. other duties along with the fire watch. 9. Maintenance director was informed to The local Fire Marshal, Brian Taylor was called perform monthly inspection on fire and a proper fire watch was begun. A Plan of Protection was completed stating the fire watch suppression system and food service will continue until the sprinkler system is certified director was shown how to perform as as working properly. well on 11/4/15. Receptacle was replaced outside of 2. Based on observation, many corridor doors room 118 on 11/7/15. are not closing well and/or latching to resist the

passage of fire and smoke. Corridor doors that do not close completely and latch present the

Cover box was installed in boiler room.

on 11/5/15.

354121

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING HAL084004 11/04/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (X5) COMPLETE PRÉFIX (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (EACH CORRECTIVE ACTION SHOULD BE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG CROSS-REFERENCED TO THE APPROPRIATE DATE TAG DEFICIENCY) C 189 | Continued From page 4 C 189 possibility that a fire that begins in one space can Prevention of Re-occurrence: quickly spread to the corridor and the remainder of the facility. Maintenance director to monitor on an ongoing Findings include: basis. a. The 1 hour rated door to the laundry does not close properly. b. The door to room 209 will not latch when closed. Completion Date: c. One of the pair of doors to the Activity room will not close and latch. All completed on or before 11/6/15 d. The pair of doors to the Dining room will not close properly and latch. e. The 1 hour door from the kitchen to the Dining room was wedged open. f. The 1 hour door from the kitchen to the Dining room would not close and latch. g. The closer has been removed on the 1 hour. door to the clean linen room. There is no other fire separation from the laundry. 3. Based on observation, the magnetic hold open devices released upon activation of the fire alarm system but then re-energized when the fire alarm system was silenced. Magnetic hold opens that re-energize before the fire alarm system is fully reset could allow smoke and fire to quickly spread throughout the facility. -4. Based on observation, some battery powered emergency lights would not work when tested. Battery powered emergency lights that will not work properly for at least 90 minutes could endanger the residents and staff. Findings include: The emergency light in the corridor near room 215 was inoperable. b. The emergency light in the Sunroom beside room 214 was missing.

Based on observation, several duct mounted

PRINTED: 11/30/2015 FORM APPROVED

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING HAL084004 11/04/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 (X4) ID PREFIX SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X5)(EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX (EACH CORRECTIVE ACTION SHOULD BE COMPLETE REGULATORY OR LSC IDENTIFYING INFORMATION) CROSS-REFERENCED TO THE APPROPRIATE TAG TAG DATE DEFICIENCY) C 189 Continued From page 5 C 189 smoke detectors are installed but no access doors are provided to allow inspection and maintenance. Sampling tubes that are not periodically inspected and cleaned can endanger all residents and staff because the duct detector ψħ... may fail to operate properly. Findings include duct detectors installed in the following spaces: a. Mechanical room off the Sunroom beside room 214. b. Mechanical room beside the Cafe. Boiler room. Based on observation the required one-hour fire rated walls and/or ceilings were compromised in several locations. Holes and penetrations that are not sealed with materials approved for use in one-hour fire rated construction present the possibility that a fire that begins in one space can quickly spread to other areas of the facility. Findings include: a. Hole in wall in file room where an emergency light has been removed. b. Unsealed sleeve (3 inch) in "House Storage" behind Executive Director's office. Hole in ceiling of boiler room. Based on Observation, the building was not maintained in a safe manner by not properly handling portable medical oxygen cylinders. This could affect all residents, staff and visitors if cylinders fall, breaking their valves, propelling the cylinder and turning it into a dangerous projectile. Findings include: Several portable medical oxygen cylinders were stored in an unapproved container in a resident bedroom. 8. Based on a review of documents, the fire

extinguishers are not being inspected monthly as

FORM APPROVED Division of Health Service Regulation (X1) PROVIDER/SUPPLIER/CLIA STATEMENT OF DEFICIENCIES (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 B. WING HAL084004 11/04/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 SUMMARY STATEMENT OF DEFICIENCIES PROVIDER'S PLAN OF CORRECTION (X4) ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL PREFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE COMPLETE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG TAG CROSS-REFERENCED TO THE APPROPRIATE DATE: DEFICIENCY) C 189 Continued From page 6 C 189 required. Failure to perform monthly safety inspections could cause the extinguisher to fail to work when needed. Findings include: The fire extingushers had not been inspected in August, September, and October. 9. Based on a review of documents, the range hood fire suppression system is not being inspected monthly as required. Failure to perform monthly safety inspections could cause the system to fail to work when needed. Findings include: The range hood fire suppression system had not been inspected since May. 10. Based on observation, the GFCI type receptacle outside the exit near room 118 would not trip when tested. GFCI type receptacles that do not work properly present a shock or electrocution risk. 11. Based on observation, there was no cover provided for an electrical junction box in the boiler room. Approved covers are required on all junction boxes. C 199 Exhaust Ventilation C 199 Plan of Correction: SECTION .0300 - PHYSICAL PLANT Reconnect exhaust fans to work properly. 10A NCAC 13F .0311 OTHER REQUIREMENTS (g) The spaces listed in this Paragraph shall be provided with exhaust ventilation at the rate of Prevention of Re-occurrence: two cubic feet per minute per square foot. This

these specified spaces: soiled linen storage;

requirement does not apply to facilities licensed

before April 1, 1984, with natural ventilation in

354121

Maintenance to monitor on an ongoing basis.

Division of Health Service Regulation STATEMENT OF DEFICIENCIES (X1) PROVIDER/SUPPLIER/CLIA (X2) MULTIPLE CONSTRUCTION (X3) DATE SURVEY AND PLAN OF CORRECTION IDENTIFICATION NUMBER: COMPLETED A. BUILDING: 01 8. WING HAL084004 11/04/2015 NAME OF PROVIDER OR SUPPLIER STREET ADDRESS, CITY, STATE, ZIP CODE 315 PARK RIDGE ROAD SPRING ARBOR OF ALBEMARLE ALBEMARLE, NC 28001 SUMMARY STATEMENT OF DEFICIENCIES (X4) ID PROVIDER'S PLAN OF CORRECTION ID (EACH DEFICIENCY MUST BE PRECEDED BY FULL PRÉFIX PREFIX (EACH CORRECTIVE ACTION SHOULD BE COMPLETE REGULATORY OR LSC IDENTIFYING INFORMATION) TAG CROSS-REFERENCED TO THE APPROPRIATE TAG DATE DEFICIENCY) C 199 | Continued From page 7 C 199 Monitor Responsibility & Frequency: (2) soil utility room; (3) bathrooms and toilet rooms; Maintenance Director to monitor on a regular (4) housekeeping closets; and basis. (5) laundry area. (k) This Rule shall apply to new and existing facilities with the exception of Paragraph (e) which shall not apply to existing facilities. Completion Date: This Rule is not met as evidenced by: November 5, 2015 Based on observation the facility failed to maintain required exhaust in a working condition. Non-functioning exhaust could cause an unhealthy buildup of moisture and possibly bacteria. Findings include exhaust not working in the following spaces; Soiled linen. b. Janitor closet, c. Laundry. d. Biohazard closet.